



Operation number: 35208-2 Operation number: 35203-2

Headlamps

Removal

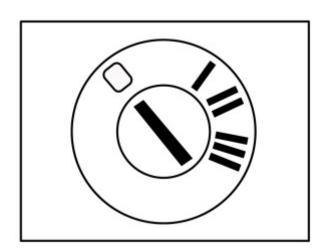

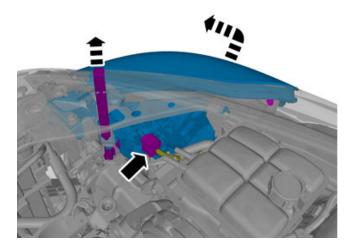

Caution!

Take extra care not to scratch the headlamp lens.


Caution!

Model: C70 (06-) Year: 2013 Engine: B5254T7



Gearbox: AW55-50/51SN

Take extra care not to scratch the bumper cover.

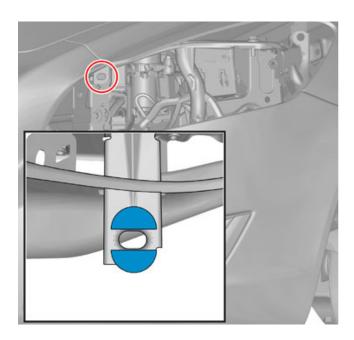

Note!
Make sure that new components are installed.

On both sides.

Installation

To install, reverse the removal procedure.

Perform headlight, adjustment Refer to: <u>Headlamps, adjusting,</u>